


DRILLER

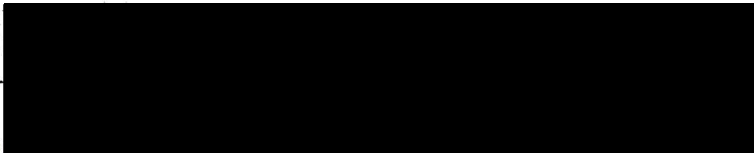

DATE JULY 31<sup>ST</sup> 2005

OVERBURDEN TYPE

LOT # 1344

QUAD 1050-14 HOT SPRINGS ROAD

FROM <u>0</u>	TO <u>137</u>	<u>DRY SILT</u>
<u>137</u>	<u>295</u>	<u>FINE DAMP SAND &amp; ROCKS</u>
<u>295</u>	<u>338</u>	<u>CLAY AND ROCKS</u>
<u>338</u>	<u>385</u>	<u>BROKEN FAULTED BEDROCK</u>
_____	_____	_____

BEDROCK

ELEVATION = 2300 FT. UNCORRECTED  
 N 60° 51.461  
135° 16.462 G.P.S.

FROM 338 TO 385

10 INCH GROUT SEAL WITH BENTONITE CHIPS

TOTAL HOLE DEPTH ----- FEET 385

STEEL CASING DEPTH ----- FEET 340 SIZE 6 INCH

P.V.C. CASING DEPTH ----- FEET \_\_\_\_\_ SIZE \_\_\_\_\_ INCH

TOP OF SCREEN ----- FEET \_\_\_\_\_

DEPTH OF AQUIFER ----- FEET 371 TO 374

STANDING WATER LEVEL ----- FEET 222

APPROXIMATE FLOW RATE ---- G.P.M. 3704

COMMENTS: BEDROCK VERY FRACTURED NOT SAFE FOR PUMP WITHOUT A LINER.

PUMP INSTALLED AND WATER SAMPLES

TAKEN - DISINFECTED WELL