

**Project Name:** Supplemental Phase II / III ESA **Test Hole ID:** MW19-18

**Project Number:** [REDACTED]

**Site Location:** Carmacks Highway Maintenance Yard

**Coordinates**


**Easting:** 433271.082  
**Northing:** 6885004.417  
**Datum:** NAD83 UTM Zone 08N

**Drilling Details**

Drill Contractor: [REDACTED]  
 Drill Date: **August 9, 2019**  
 Drill Method: **Sonic**  
 Maximum Drilled Depth (mbgs): **9.1**  
 Drillhole Diameter (mm): **152**

**Vapour Well: SV19-18**

Top of Sand Pack (mbgs): **1.22**  
 Probe Interval (mbgs): **1.25 - 1.5**  
 Probe Diameter (mm): **15**  
 Probe Material: **Stainless Steel**  
 Leak Test Passed: **Yes**  
 Leak Test Date: **August 13, 2019**

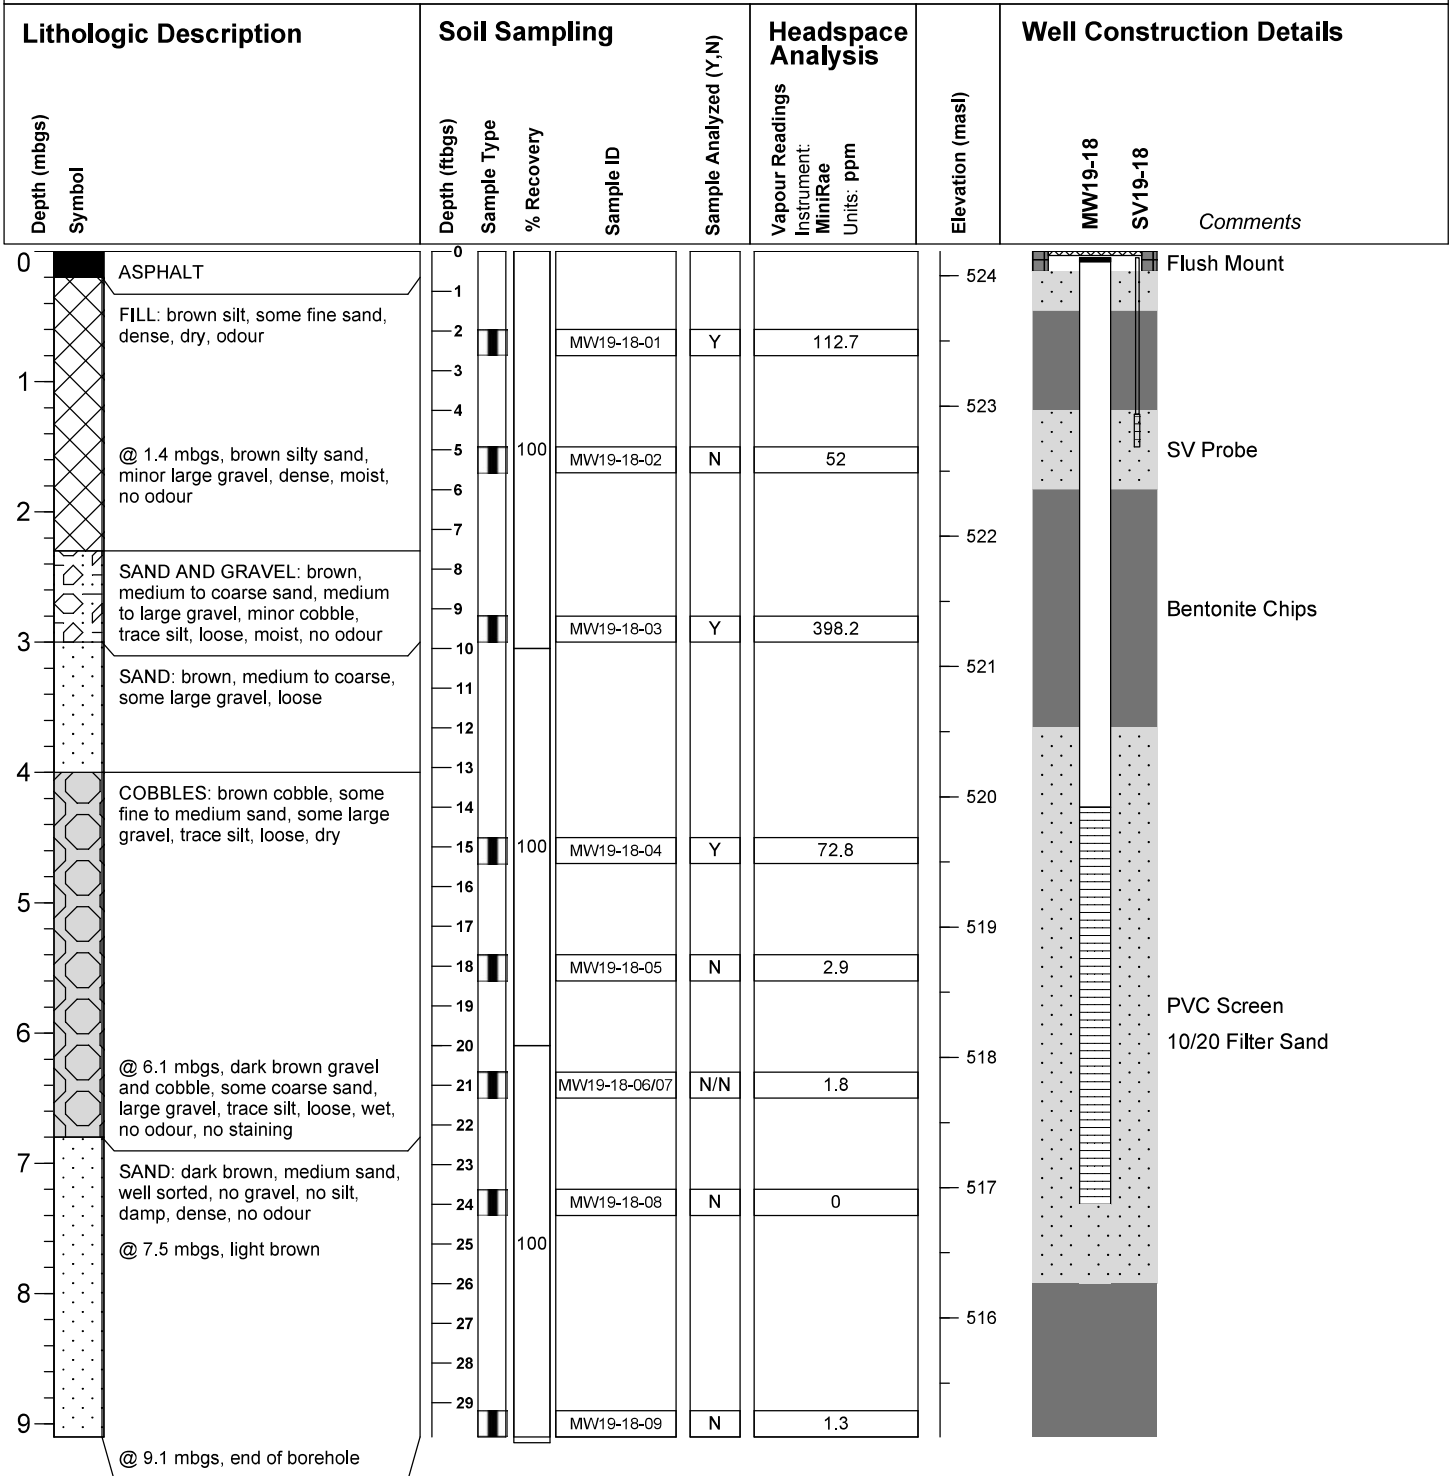

**Report Date:** August 2019  
**Logged by:** [REDACTED]  
**Approved by:** [REDACTED]  
**Client:** Yukon Government

**MW19-18**

Top of Casing Elevation (masl): **524.136**  
 Ground Elevation (masl): **524.187**  
 Screen Interval (mbgs): **4.27 - 7.32**  
 Depth to Bottom (mbTOC): **7.25**  
 Depth to Water (mbTOC): **5.244**  
 Water Level Date: **August 13, 2019**  
 Casing Diameter (in): **2**  
 Screen Slot Size: **10**  
 Casing Material: **PVC**