WHITEHORSE SEWAGE TREATMENT FACILITY	CLIENT: STANLEY ASSOCIATES ENGINEERING	TEST PIT NO: 11482-TP91
SAND BORROW SEARCH	EXCAVATOR: CAT 225	PROJECT NO: [redacted]
WHITEHORSE, YUKON	UTM ZONE: 8 N6741246.1 E495097	ELEVATION: 685.50 (m)

SAMPLE TYPE ■ GRAB ▨ NO RECOVERY

DEPTH(m)	SAMPLE TYPE	SAMPLE NO	USC	SOIL SYMBOL	SOIL DESCRIPTION
0.0					ORGANIC ROOT MAT
					SAND – silty, some rootlets and organics; yellowish brown
	■	1			SAND – trace of silt; fine grained; frozen; light yellowish brown
1.0					
	■	2			– colour changes to light grey below 1.0 m
	■	3			– seasonally frozen to 1.8 m
2.0					
	■	4			
3.0					
4.0					
	■	5			
					END OF TESTPIT @ 4.7 m – no water – little sloughing
5.0					
6.0					

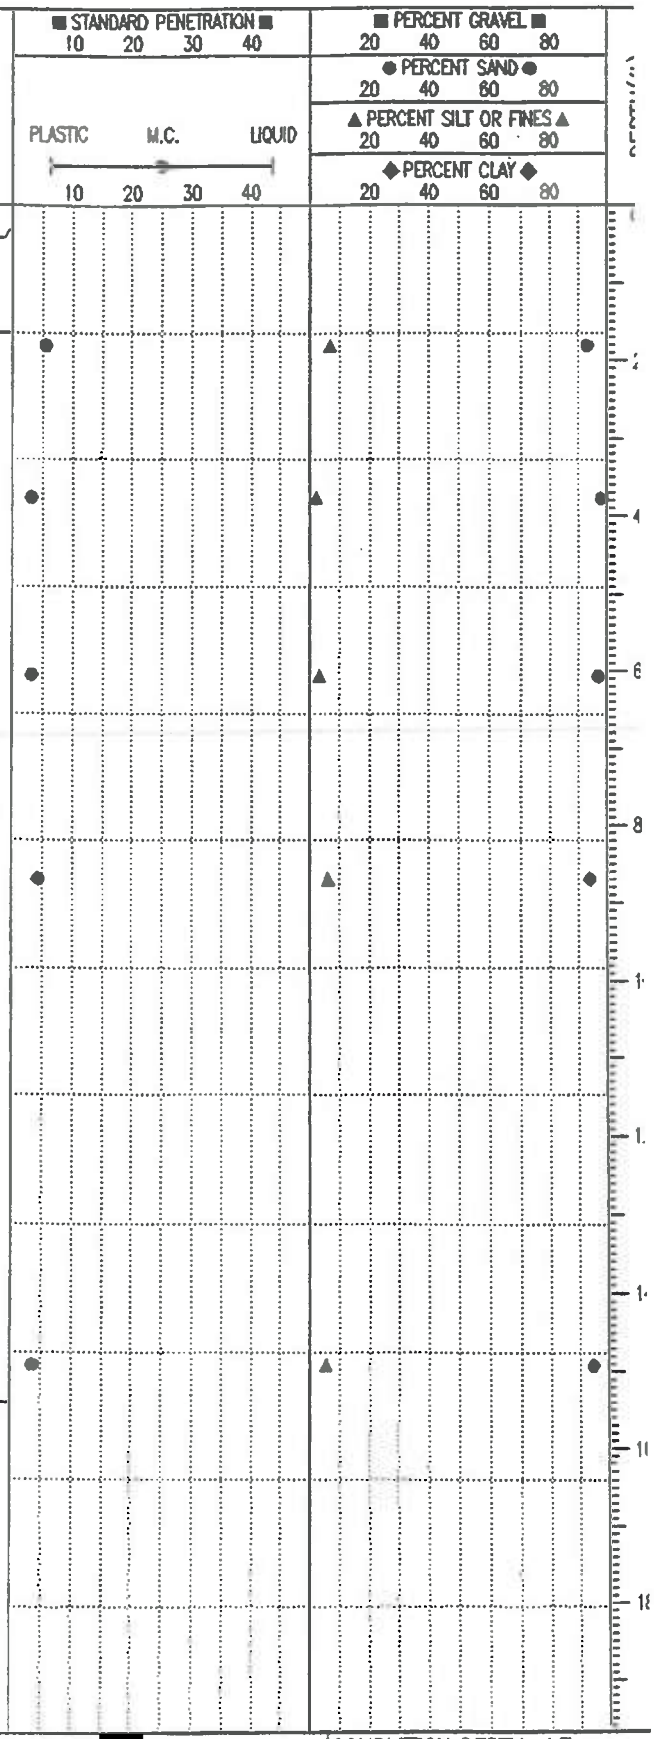

EBA Engineering Consultants Ltd. Whitehorse, Yukon	LOGGED BY: [redacted]	COMPLETION DEPTH: 4.7 m
	REVIEWED BY: [redacted]	COMPLETE: 95/03/08
	Fig. No:	Page 1 of

95/04/13 03:13PM (YUKON-T6)