




FIELD REPORT

#204140373

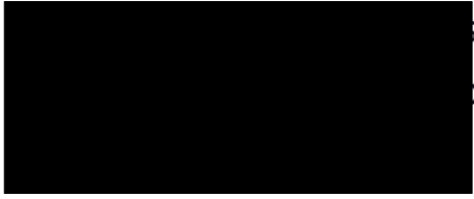

started... July 13... 19.78  
 completed... July 19... 19.78

NAME AND ADDRESS OF CLIENT	DESCRIPTION OF WORK	LOCATION OF WORK
[Redacted]	WATER WELL	MILE 10 MAYO ROAD AND TO RIGHT HAND SIDE.
Box 4391 WHITEHORSE Y.T.		

FORMATION LOG			DESCRIPTION OF WORK	TIME			
FROM	TO	FORMATION		DATE	FROM	TO	HOURS
			MOVE				
			LOADING	JULY 13	13:00	15:00	2
			MOVING ON SETTING-UP	14	07:00	09:30	2.5
0'	15'	BROWN SILT			09:30	16:00	6.5
15'	72'	GREY SILT					
72'	108'	GREY CLAY					
108'	165'	BROWN CLAY		JULY 17	09:00	16:00	7
165'	175'	BEDROCK BROWN GRAY BLACK		JULY 18	08:00	18:00	10
175'	208'	BEDROCK BROWN GRAY BLACK					
208'	227'	GRANITE BLACK GRAY					
227'	230'	WHITE CRUMBLY ROCK GRAY					
230'	244'	BLACK					
			1 HR. DEVELOPING				
			MOVING OFF	JULY 19/78	08:00	12:00	4

Rcd. of Casing & Pipe				Remarks:
Size	Type	Size	Type	
5/8"	.280 WALL			1/2 GAL/min
feet	Inch	Feet	Inch	
20'	10"	17'	1/2"	
20'	7 1/2"	20'	6 3/4"	
20'	7 3/4"	4'	9 1/2"	
18'	11 1/4"			
22'				
20'	7 1/2"			STATIC LEVEL
		166 1/2'		Ground level
				Top of casing 10'6"
				Total Rig Time 32 hrs.
				Total Standby — hrs.
				Drilling Mud — sacks

MIDNIGHT SUN... [Redacted] ...DRILLER  
 TITLE... [Redacted] ...Helfon

CLIENT.....  
 TITLE.....



# Midnight Sun Drilling Co. Ltd.

DATE July 20/78

# 204140373

PAGE NO. 1

PROJECT [REDACTED]

Pg. 2

