

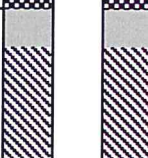


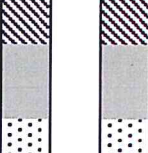

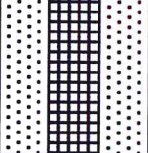


Project		Groundwater Monitoring Well Installations		Project #		W801500	
				BH number		MW05a	
Location		Al's Environmental Cleanup Inc. LTF		Zone		08V	
LSD				GPS		0457298 E 7057954 N	
Community		Mayo, YT		Elevation (mas)		560	
Sample type	<input type="checkbox"/> Disturbed	<input checked="" type="checkbox"/> No Recovery	<input checked="" type="checkbox"/> SPT	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>
Backfill type	<input checked="" type="checkbox"/> Bentonite	<input checked="" type="checkbox"/> Slough	<input checked="" type="checkbox"/> Concrete	<input checked="" type="checkbox"/> Filter sand	<input checked="" type="checkbox"/> Drill cuttings	<input type="checkbox"/>	<input type="checkbox"/>
Depth (m)		Soil Discription		MW05a		Sample Type	Depth (m bgs)
from	to						
+0.67	0	PVC stick up					
0.00	0.46	Organics					
0.46	2.44	SILT, sand, trace clay and gravel, dry light brown 0.46 m top of bentonite 1.3 m top of drill cuttings					
2.44	3.00	GRAVEL sand, trace silt, dry light brown					
3.00	11.28	SILT, SAND, gravel, dry light brown					
11.28	12.90	GRAVEL, silt, sand, dry brown 12.5 m top of bentonite 12.5 m harder drilling 12.8 m top of sand					
12.90	14.00	GRAVEL, SAND, cobbles trace silt, dry 13.41 m top of screen					
14.00	17.98	GRAVEL, SAND, cobbles, moist grey brown 17.68 m harder drilling 17.98 m bottom of well					
		End of hole at 17.98 m					▼ 17.83
West 80 Environmental Consulting Ltd.							